


LYNX: MALE 50 PIN 'D'

OTARI: MALE 20 PIN HONDA

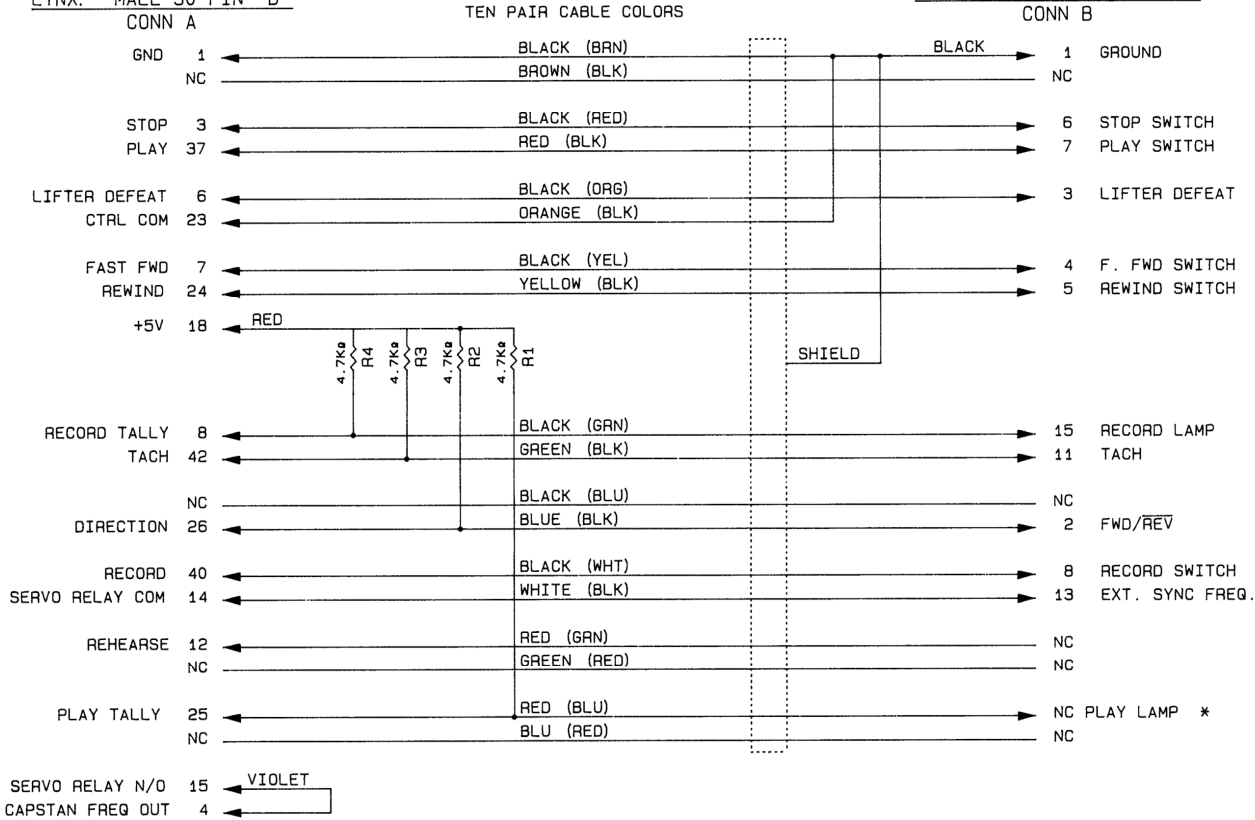

REV	DESCRIPTION
001 7-86	REMOVED OTARI PIN 12 & LYNX PIN 31.
002 5-87	ADDED R2 FOR REC TALLY PULLUP
00A 11/1/88 AD	DWG# 30-0018-00A WAS FILE MTR10-1.002. CABLE COLOR AND UNUSED PAIR INFO ADDED. LYNX PIN 12 ADDED.
B 1/3/90 BT	ADDED PLAY TALLY; ADDED MACHINE SIGNAL NAMES; CHANGED DWG.# WAS 30-0018-00A

TEN PAIR CABLE UNUSED PAIRS:
RED (WHITE) AND WHITE (RED)

NOTE:
* = PINNED BUT NOT INSERTED. COVER WITH CLEAR SHRINK TUBE. PIN 16, PLAY LAMP, MAY ONLY BE CONNECTED IF OTARI 2A-53F OPTIONAL TALLY INVERTER IS FITTED TO MACHINE.

(C) 1989 TIMELINE, INC. 270 Lafayette St. New York, N.Y. 10012		APP'D <i>MC</i>
SCHEMATIC CABLE ASSEMBLY OTARI MTR 10/12-1		CHK'D <i>BT</i>
CONFIDENTIAL	DATE	1/3/90
DWG	REV	PAGE
70D025-20	B	1
	SIZE	B